

Until now the commonly requested retrofits in the X150 XK/XKR models were difficult because of the programming limitations in SDD, a Jaguar dealer usually could not help because the CCF editing routines required a password for access. To help make these jobs easier, we have added the missing routines.

- AUX Audio Input
- Reverse Camera
- DAB+ Digital Radio

In addition to the retrofit hardware, car configuration file changes are required.

Note that Reverse Camera or DAB+ are only possible on 2009MY-onward vehicles, starting from VIN B27987-onward, if you have an earlier car prior to B27987, the software in the Touchscreen (FCDIM) and Gateway (ICM) must be updated to 2009MY version in order for these features to work. Please see separate documentation about this update and contact us info@oldjaguar.com for support.

We have also provided guides for the retrofit hardware and installation process in the car, if you need components or wiring, of course contact us we can provide these too.

Requirements


- JLR SDD diagnostic tool, version after 146.02, with online access. (we are not providing SDD, don't ask).
- Battery tender to maintain voltage during programming.

There is a different upgrade file depending on 32bit or 64bit Windows, please download & install the correct version.

Download from <https://uds.oldjaguar.com/x150/>

Installation


Run the exe file, the destination folder already exists so if asked just confirm with yes.

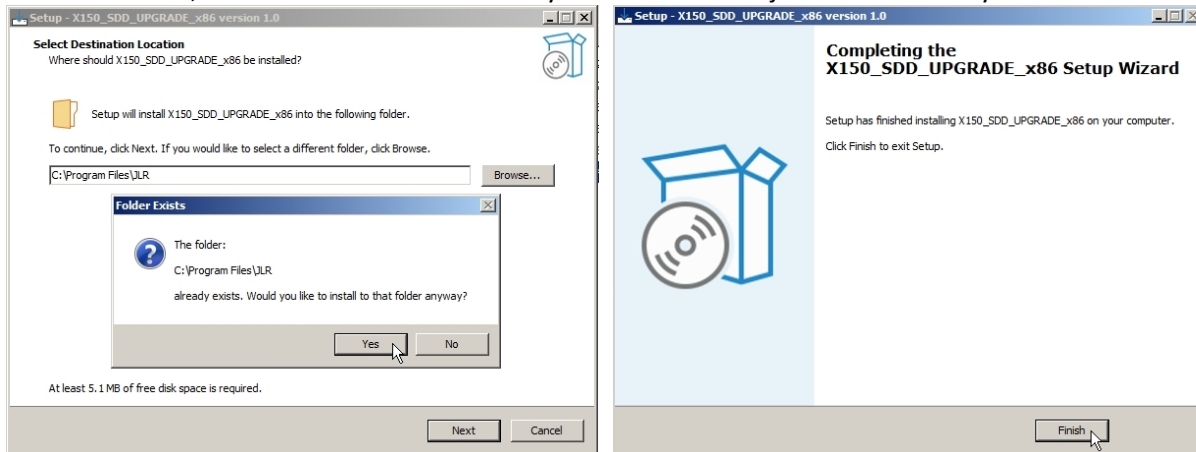


Once completed you are now ready to do your retrofits with SDD.

Programming Process


Go to Service Functions tab, and run Add/remove accessories – in2digi D-JLR series digital radio

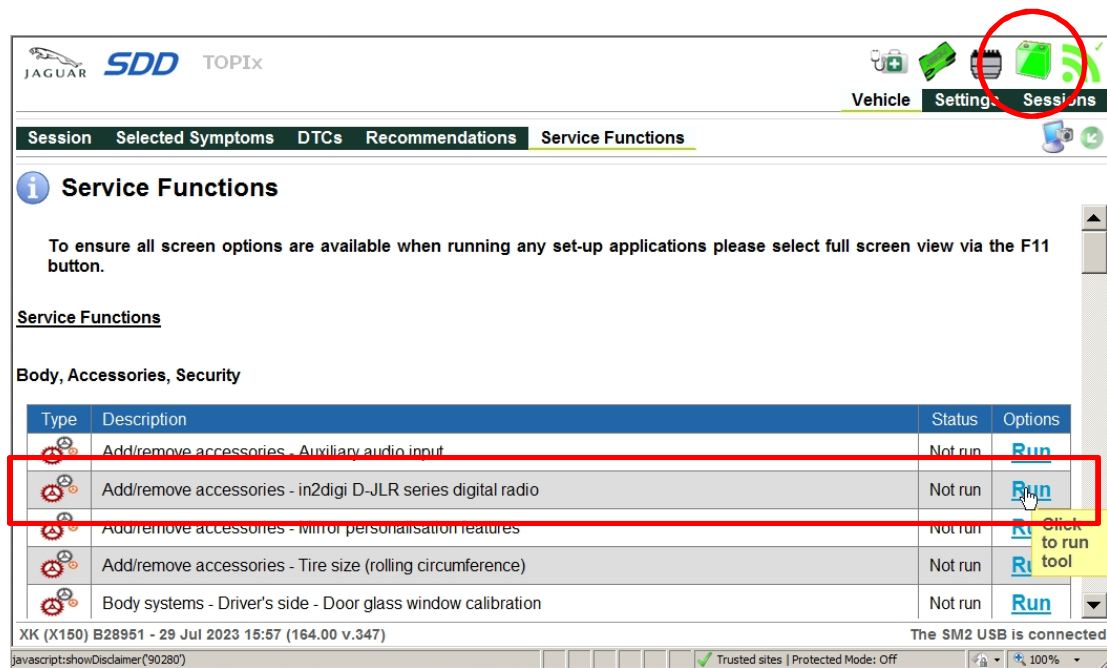


Follow the instructions on the screen. If you are asked about the software version of the FSJB then choose "NEW"

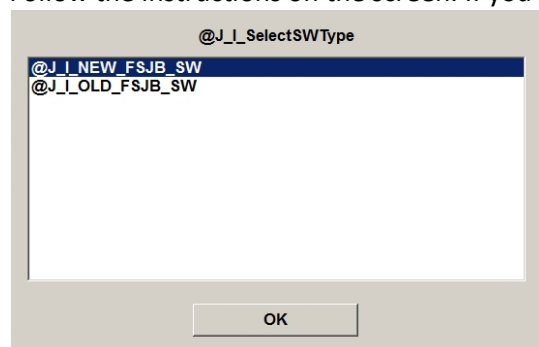


Will be given a choice between, AUX, Camera or DAB, if you need to do multiple activations, then you will have to repeat this process for each.

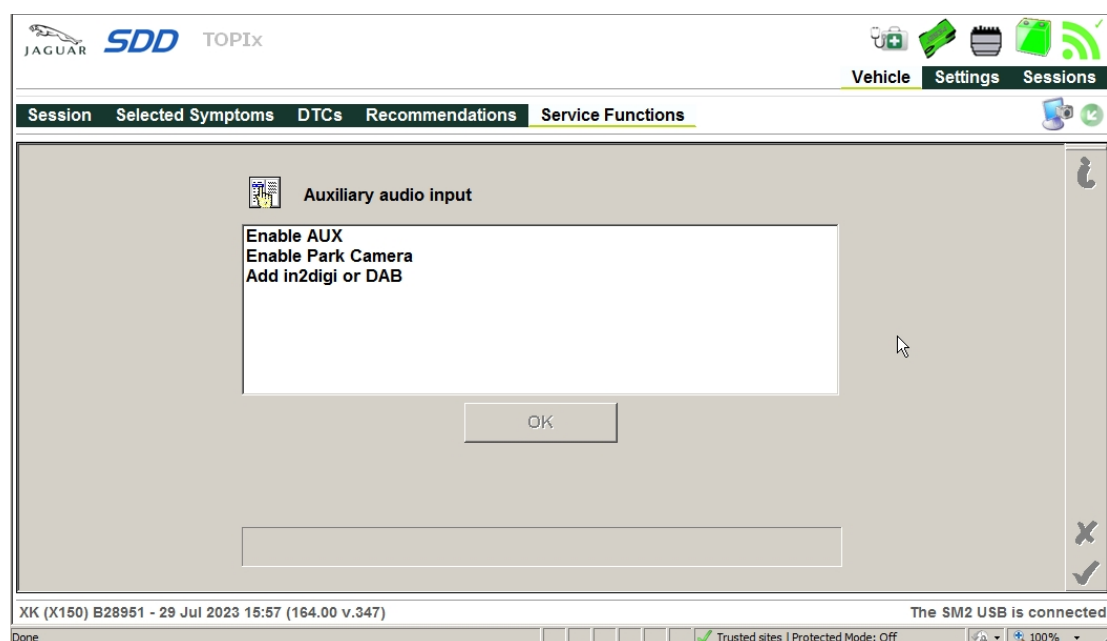

Make your selection and follow the instructions on the screen

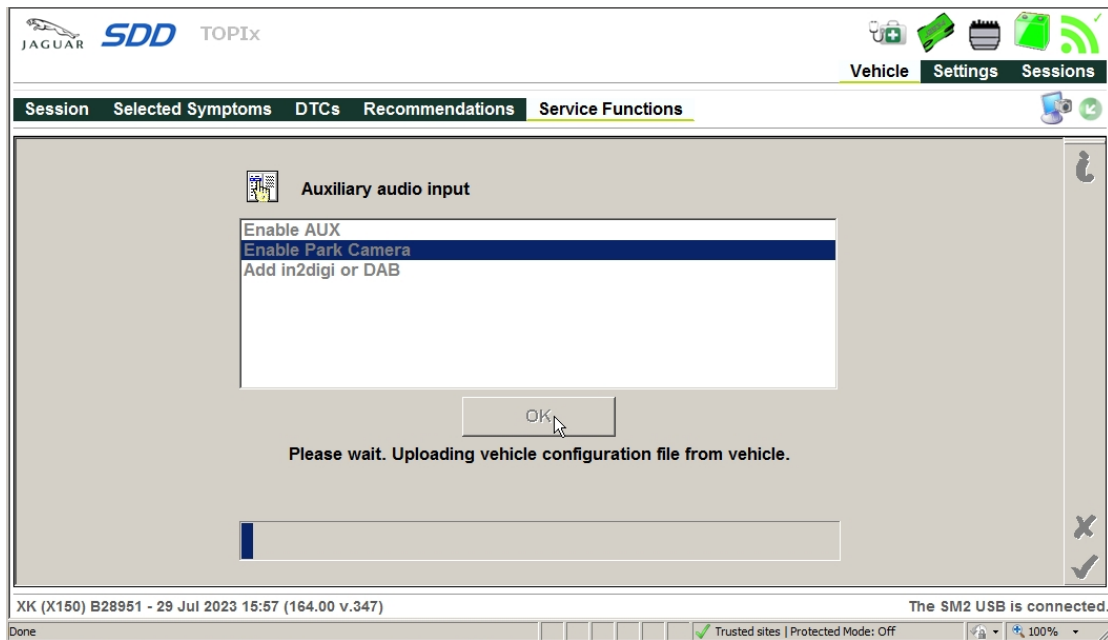

Upon completion, regardless of which routine you chose the confirmation message will say AUX, this is a limitation in the available text in SDD.

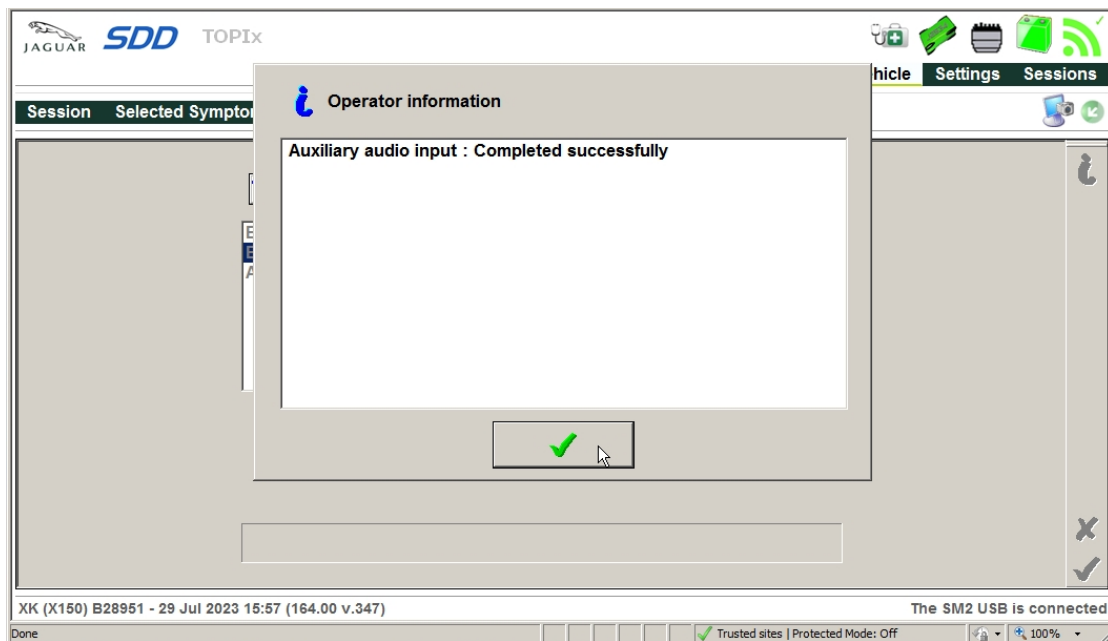

NOTE

After programming it's common for the vehicle to have errors on the dash even after faults are cleared, you may need to start the engine and cycle the ignition a couple of times.
You will also need to reset the parking brake "apply foot and park brake".

Contact

email: info@oldjaguar.com for technical support or purchasing.

Old Jaguar Group

www.oldjaguar.com

www.facebook.com/oldjaguarau

www.facebook.com/OldJaguarLive

<https://twitter.com/OldJaguarLive>

www.instagram.com/oldjaguarlive

www.instagram.com/noswarehouse